

STOP USE AND INSPECTION NOTICE

IMMEDIATE ACTION REQUIRED

Remove product from service until inspection is performed.

3M™ DBI-SALA® Delta™ Vest-Style Harness - CANADA CSA VERSIONS ONLY

As part of 3M Fall Protection’s ongoing commitment to delivering high quality safety equipment, we are notifying our customers of the following information related to specific CSA versions of the 3M™ DBI-SALA® Delta™ Vest-Style Harness. 3M Fall Protection has identified a potential manufacturing issue with a limited number of harnesses produced between November 1, 2020 and May 31, 2021 that were assembled with the webbing improperly routed through the dorsal D-ring.



This manufacturing issue will result in the harness not performing properly in the event of a fall, which could result in severe injury or death. Due to this, we are sending out an inspection notice so this issue can be detected by inspecting the harness as shown below.

Product	Date of Manufacture	Part/Model Number
3M™ DBI-SALA® Delta™ Vest-Style Harness	Between November 1, 2020 – May 31st, 2021	1102000C
		1103321C
		1110600C
		1110602C


End Users: Please follow the steps listed below.

Step 1: **Remove product from service until inspection is performed.**

Step 2: Locate the label on the harness (see photograph to right) to determine the model number and if it was manufactured between November 1, 2020 and May 31, 2021. If the harness is an impacted model and was manufactured in the affected date range, please continue to Step 3.



Step 3: Once you have confirmed the part number & affected date, inspect the connection from the dorsal D-ring to ensure the webbing is properly routed through the D-ring, as shown in the images below. If the harness passes the inspection, it is acceptable for use. If the harness does not pass inspection, contact our Customer Service Department to arrange to have the harness replaced, as per our standard warranty.

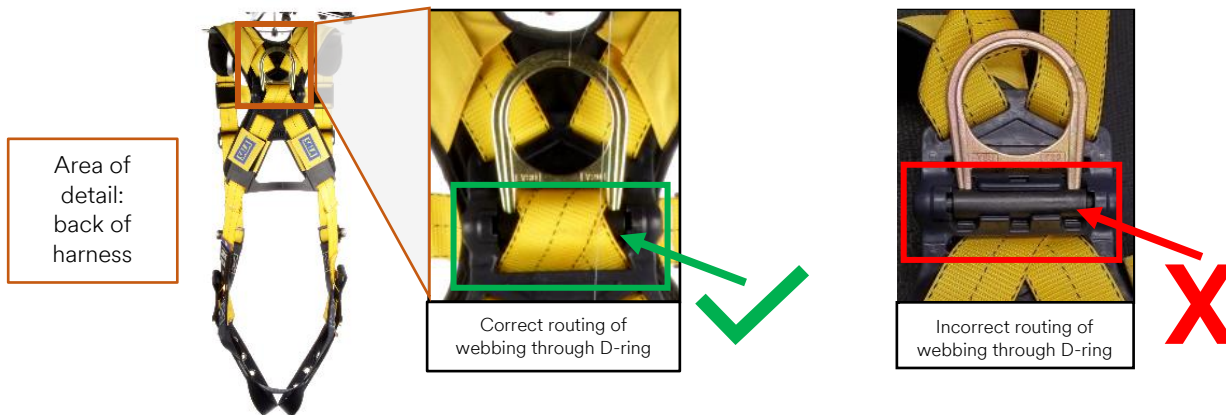

If you have any questions, please contact our Customer Service department at 3mcafpserviceaction@mmm.com or at 1-833-998-2243.

Distributors: Please contact our Customer Service department at 3mcafpserviceaction@mmm.com or at 1-833-998-2243 to obtain a listing of all affected 3M™ DBI-SALA® Delta™ Vest-Style Harness(es) sold to you. Please forward this “Stop Use and Inspection Notice” to any of your customers/users who have purchased the harnesses listed above from you. If you have any inventory of the affected models, please contact our Customer Service department to have them returned.